

Work Order ID 105594

\*105594\*

Page 1

August-08-13 1:00:26 PM

Item ID: D205-634-041

Accept

\*N900040100\*

Setup Start

\*NS1\*

Revision ID:

Stop

\*NS2\*

Item Name: Replacement Skidtube Fits LH or RH

Start Date: 8/08/13

Start Qty: 2.00

\*2\*

Cust Item ID:

Required Date: 8/08/13

Req'd Qty: 2.00

\*2\*

Customer:

Reference: RA111596

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

\*NR1\*

QC:

Date:

SPC (Y/N):

Date:

Stop

\*NR2\*

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

Draw Nbr

Revision Nbr

D2580-041

F

100

0.00

\*100\*

DOCUMENT CONTROL

DC

Memo

0.00

Document Control

WHITE LABELS ONLY - NO B/N

130

QC5- Inspect part completeness to step on W/O

0.00

\*130\*

QC

Memo

0.00

Quality Control

INSPECT RA111596  
RECORD S/N

140

0.00

\*140\*

Skid tubes

Memo

0.00

Skid tubes

STEP 2 ON REPAIR SCHEME 1010

2 0 13/08/09



Work Order ID 105594

\*105594\*

Page 2

August-08-13 1:00:26 PM

Item ID: D205-634-041

Accept

\*N900040100\*

Setup Start

\*NS1\*

Revision ID:

Stop

\*NS2\*

Item Name: Replacement Skidtube Fits LH or RH

Start Date: 8/08/13 Start Qty: 2.00

\*2\*

Cust Item ID:

Required Date: 8/08/13 Req'd Qty: 2.00

\*2\*

Customer:

Reference: RA111596

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start

\*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

\*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150	QC10- Inspect visual per QSI004- ground welds	0.00							
*150*	<i>S QCS inspect Removal at 2 paces</i>								
QC	<i>B10/08</i> Memo	0.00							
Quality Control	STEP 3 ON RS1010								
155		0.00							
*155*									
Skidtubes	Memo	0.00							
Skidtubes	STEP 4 ON RS1010								<i>DL/man 13/08/12</i>
165		0.00							
*165*									
QC	Memo	0.00							
Quality Control	STEP 5 ON RS1010								



# Work Order ID 105594

**\*105594\***

Page 3

August-08-13 1:00:26 PM

Item ID: D205-634-041 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Replacement Skidtube Fits LH or RH  
 Start Date: 8/08/13 Start Qty: 2.00 **\*2\*** Cust Item ID:  
 Required Date: 8/08/13 Req'd Qty: 2.00 **\*2\*** Customer:  
 Reference: RA111596

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170	Pressure Wash per QSI005 4.3	0.00							
<b>*170*</b>									
HandFinish	Memo	0.00							
Hand Finishing	STEP 4A ON RS1010								
175		0.00							
<b>*175*</b>									
QC	Memo	0.00							
Quality Control	STEP 5 ON RS1010								
220		0.00							
<b>*220*</b>									
Packaging	Packaging	0.00							
Packaging	Memo								
Packaging	REPACKAGE - NO B/N REQ'D SEE QC FOR PAPERWORK - NO ARC								

2 X 4 m/f 13/08/12

DAS  
16  
9-89 13/08/12

1 8 13-8-13



**Work Order ID 105594****\*105594\***

Page 4

August-08-13 1:00:26 PM

Item ID: D205-634-041

Accept

**\*N900040100\***

Setup Start

**\*NS1\***

Revision ID:

Stop

**\*NS2\***

Item Name: Replacement Skidtube Fits LH or RH

Start Date: 8/08/13 Start Qty: 2.00

**\*2\***

Cust Item ID:

Required Date: 8/08/13 Req'd Qty: 2.00

**\*2\***

Customer:

Reference: RA111596

Run Start

**\*NR1\***

Approvals:

Process Plan:

Date:

Tooling:

Date:

Stop

**\*NR2\***

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

230

QC21- Final Inspection - Work Order Release

0.00

**\*230\***

QC

Memo

0.00

Quality Control

CLOSE W/O FOR 0

SEE PAT S/ QC FOR PAPERWORK- NO ARC

MCS 1308-13

MF

13-8-12





# Picklist Print

August-08-13 1:00:24 PM

Page 1

Work Order ID: 105594

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube Fits LH or RH

Start Date: 8/08/13

Required Date: 8/08/13

Start Qty: 2.00

Required Qty: 2.00

Comments: IPP Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30  
 KJ IPP Rev P 10.02.19 per PAR09-043 EC  
 verified by:DD  
 IPP Rev. O 06.02.28 Added paperwork EC  
 IPP Rev:P 07-07-09 SS Wearplates & Gaskets JLM IPP Rev:Q 10.12.01 as per chg003  
 DD verf:EC IPP REV:R 12.01.23 AS PER ECN11-684 VER:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
AN3-5A Bolt		Purchased	No				Each	680.0000		X4		Jul 13/08/12	
				<u>Location</u>		<u>Loc Qty</u>	<u>Loc Code</u>						
				FP001		12							
				122800		12							
				GA		120							
				117423		120							
				ST350		22							
				120187		22							
				ST512		526							
				122416		19							
				124561		507				X4			
D205-634-041 Replacement Skidtube Fits LH or RH		Manufactured	No				Each	6.0000		2			
				<u>Location</u>		<u>Loc Qty</u>	<u>Loc Code</u>						
				FG		2							
				87804		1							
				98808		1							
				FG073		4							
				100659		1							
				102221		1							
				102625		1							
				99575		1							



# Picklist Print

August-08-13 1:00:26 PM

Page 2

Work Order ID: 105594

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube Fits LH or RH

Start Date: 8/08/13

Required Date: 8/08/13

Start Qty: 2.00

Required Qty: 2.00

D4202-1  
Spacer

Manufactured No

Each 609.0000

8

Location

Loc Qty

Loc Code

LG

605

96906

4

98699

69

99216

532

LG002

4

97447

4

NAS1149D0332J

Purchased No

Each 2,841.0000

Washer

Location

Loc Qty

Loc Code

ST293

37

125268

37

ST294

2804

122973

106

125044

278

m125807

2420

u x 4 13/08/12

x 4

August-08-13 1:00:26 PM

Shop Packet Print

Page 2







<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	
<b>Description:</b> Repair Scheme for Canadian D205-634-041 Skidtube (Replacing crack crossbolt spacers)			
<b>Drawing:</b> D2580-041		<b>Repair Scheme:</b>	<b>RS1010</b>
<b>Part No:</b> D205-634-041		<b>Page:</b>	<b>2 of 1</b>
<b>Batch No:</b>		<b>Qty:</b>	


Rev	Date	Change Description	Prepared	Checked	Approved
A	13.04.04	New Issue	DD		

U:\Admin\Forms\RepairschembIA.doc

Rev. A





# RA 111596 D205-634-011

## Re-work

Received @ Dart August 2<sup>nd</sup>, 2013  
Inspected @ Dart August 6<sup>th</sup>, 2013

CUSTOMER: CANADIAN HELICOPTERS  
CUSTOMER CONTACT: CHRIS WIERINGA  
SHIPPED FROM: LES CEDERS PQ, CANADA

1596  
Instructions for RA 111585 D205-634-041 C130729A & C130729  
Re-work

- Tubes are here for re working same re work scheme that David Duvall had original created for the previous re work
- Remove all cross bolt spacers in the fwd. & aft saddles and the GHW areas
- Remove the aft cap
- Swage in new D4202-1 per DEO D2580-E-1
- "clean" up only area around the saddles and GHW and re alodine in those locations
- Reinstall aft cap with new sikaflex and with new AN3-5A bolts and NAS1149D0332J washers qty x 2 each of each skid tube

- 
- Both tubes need the same re-work work orders
  - Were removed from aircraft C-FYZE
  - Removal tags are with the RA

Time Estimate = 10 HOURS

Departments Required: Stores, Landing Gear & Finis

Pictures Attached = NO

QTY INSPECTED = x1 D205-634-041 ????  
x1 D205-634-041 ????

6463810

**THIS INSTRUCTION SHEET MUST  
BE ATTACHED TO THE  
RESTOCKING WORK ORDER AT  
ALL TIMES!!!!**



LIST OF MATERIALS					
ITEM	QTY -041	QTY -045	QTY -047	PART NUMBER	DESCRIPTION
1	X			D2580-041	SKIDTUBE ASSEMBLY
2		X		D2580-045	SKIDTUBE ASSEMBLY
3			X	D2580-047	SKIDTUBE ASSEMBLY
4	1	1	1	D2500-1-190	EXTRUSION
5			18	D2570	BUSHING
6	1	1	1	D2576-3	STEP
7		4		D2579	SPACER
8	16	16	8	D2594-1	PLUG
9	16	16	8	D2594-3	O-RING
10	1	1	1	D2596	205 WEB
11	1	1	1	D2855	AFT CAP
12	1	1		D3564-5	WEARSHOE
13	1	1		D3564-9	WEARSHOE
14	1	1		D3564-11	WEARSHOE
15	1	1		D3564-13	WEARSHOE
16	2	2		D3566-1	GASKET
17	1	1		D3566-5	GASKET
18	1	1		D3566-13	GASKET
19	20	20	24	D4202-1	SPACER
20			1	D4406-041	WEARPLATE ASSEMBLY
21			1	D4406-043	WEARPLATE ASSEMBLY
22	50	50		ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
23	50	50		AN3C4A	BOLT
24	2	2	2	AN3-5A	BOLT
25			8	AN4-45A	BOLT
26	50	50		NAS1149C0332R	WASHER (AN960C10L)
27	2	2	2	NAS1149D0332J	WASHER (AN960JD10L)
28			8	MS21042-4	NUT (OR MS21042L4)

# GENERAL NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ASSEMBLY (-041/-047) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.2  
POWDER COAT ASSEMBLY (-045) GREEN SANDEX (REF 4.3.5.8) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 34.5 lbs  
D2580-045 = 34.5 lbs  
D2580-047 = 37.7 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241-281.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION


RELEASED  
2013-07-13

F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1: REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS D2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.18
REV.	DESCRIPTION	BY	DATE
DESIGN	DC	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	DC		
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DD	D2580	SHEET 1 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	HS	205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	COPYRIGHT © 1996 BY DART AEROSPACE LTD. THIS DOCUMENT IS REVIEWED AND CORRECTED, WORKS BUILT ON THE BASIS OF THE CONDITIONS LISTED IN THE NOT TO BE USED FOR ANY PURPOSES OR COMES OR COMMENCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	








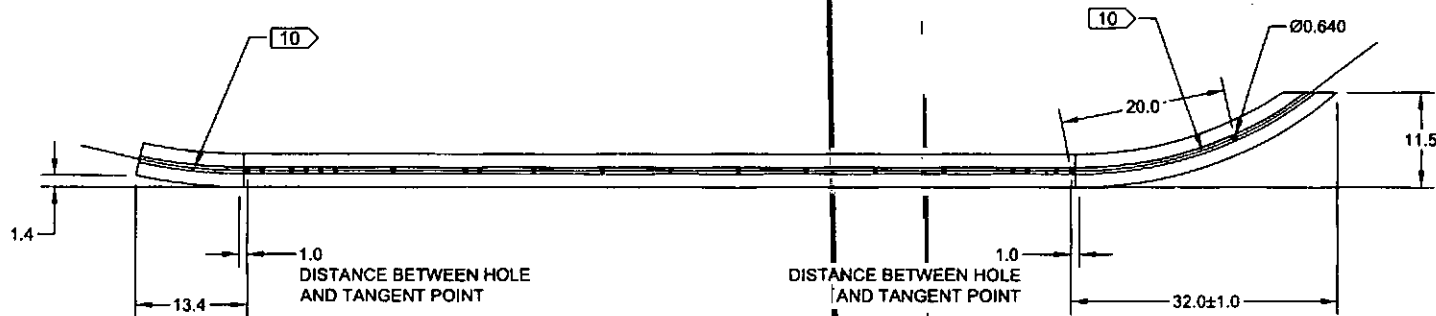

D2580-1 BENT TUBE  
(MAKE FROM D2580-101 TUBE)

**RELEASED**  
2013-07-15


DESIGN	DC	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DD	DRAWING NO.	REV. F
MFG. APPR.	HS	D2580	SHEET 3 OF 8
APPROVED	NTS	TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	<small>COPYRIGHT © 1986 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. AND IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

 







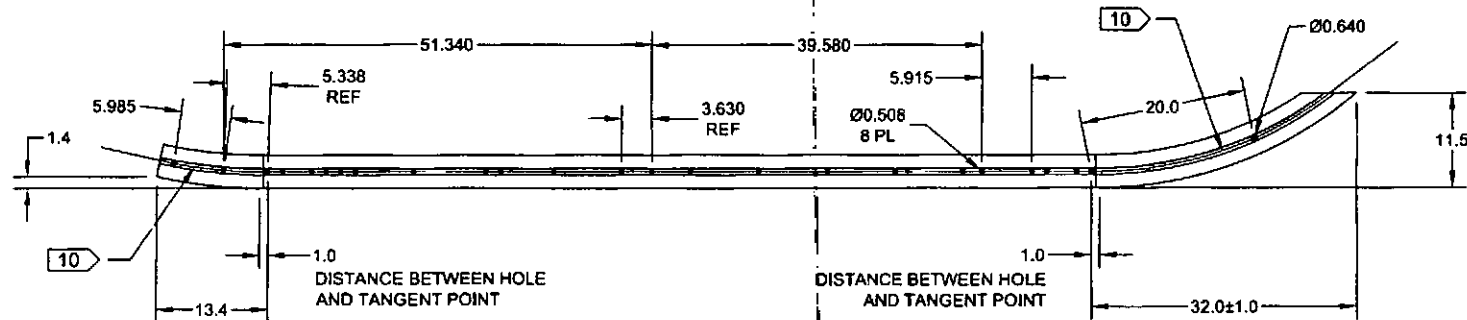


**D2580-5 BENT TUBE**  
(MAKE FROM D2580-101 TUBE)

**RELEASED**  
2013-07-15  
*MD*


DESIGN	CH	<b>DART AEROSPACE LTD</b>	
DRAWN	DC	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DD	D2580	SHEET 5 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	CH	205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	



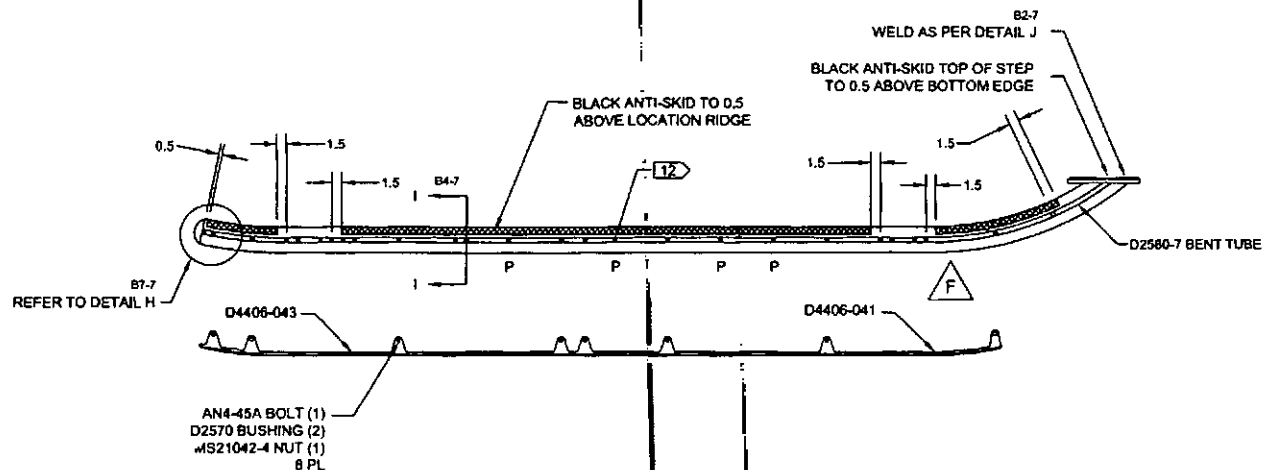


D2580-047 ASSEMBLY DETAIL

DETAIL H 06-7  
SCALE 5X

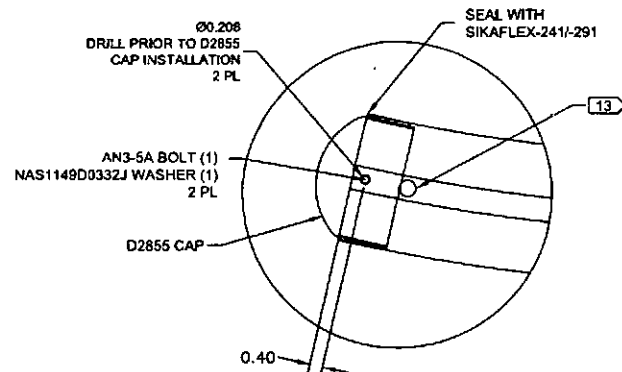


SECTION I-I 05-7  
SCALE 5X

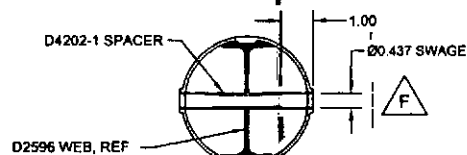

AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:  
1. INSERT D4202-1 SPACER (24 PLACES)  
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002  
3. TRIM/GRIND FLUSH PER QSI 002


DETAIL J 03-7  
SCALE 5X

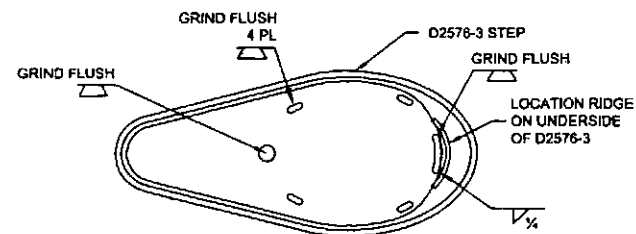

DESIGN	4	<b>DART AEROSPACE LTD</b>	
DRAWN	DC	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DD	D2580	SHEET 6 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	4	205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	<small>COPYRIGHT © 1986 BY DART AEROSPACE LTD THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE OPEN SOURCE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

RELEASED  
2013-07-15



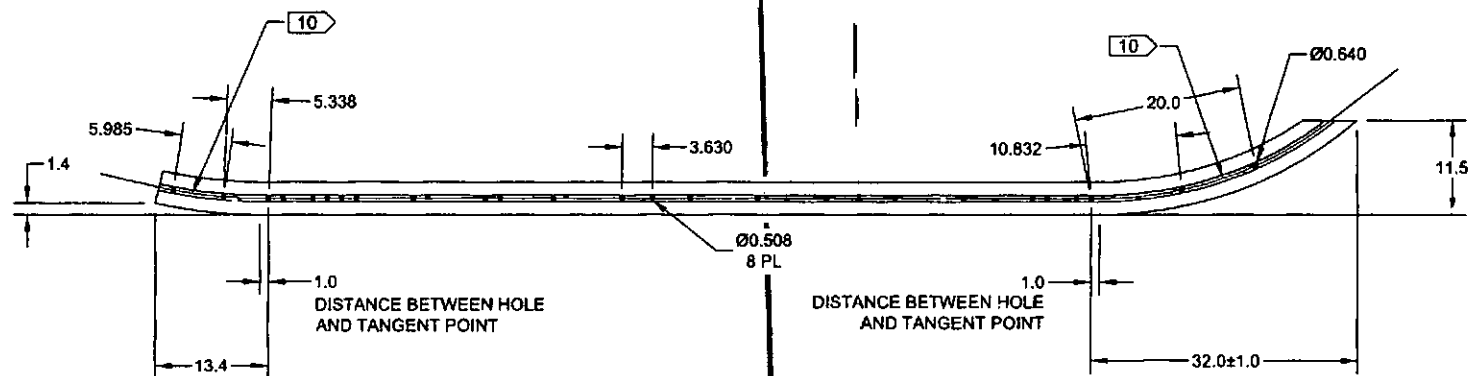

D2580-7 BENT TUBE  
(MAKE FROM D2580-101 TUBE)


RELEASED  
2013-07-15

DESIGN	DC	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. F
CHECKED	DD	D2580	SHEET 7 OF 8
MFG. APPR.	HS	TITLE	SCALE
APPROVED	NTS	205 SKIDTUBE ASSEMBLY	NTS
DE APPR.		DATE	13.06.20


COPYRIGHT © 1998 BY DART AEROSPACE LTD  
THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE TO THE PUBLIC ON THE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR THE DISSEMINATION OF INFORMATION WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE LTD.





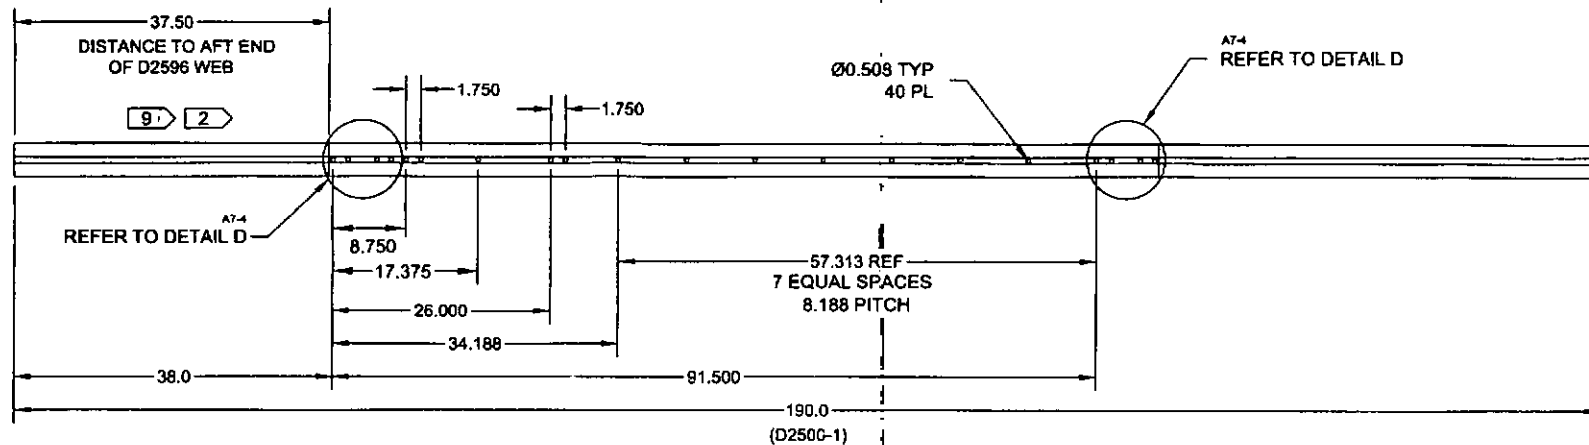

D2580-101 TUBE

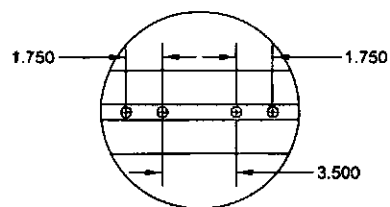

DETAIL D D3-4  
SCALE 5X C7-4

RELEASED  
2013-07-15

DESIGN	4	DART AEROSPACE LTD	
DRAWN	DC	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DO	D2580	SHEET 8 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	4	205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	COPYRIGHT © 1986 BY DART AEROSPACE LTD	
THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE FOR REPRODUCTION IN WHOLE OR IN PART FOR ANY PURPOSE OR FOR ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

